

SECTION 1: Identification

1.1. Product identifier

Product form : Mixture
Name : Argon/Oxygen Mixture
Other means of identification : StarGold O1, O2, O5;
Mixtures of Argon and Oxygen
Product group : Core Products

1.2. Recommended use and restrictions on use

Recommended uses and restrictions : Industrial use
Use as directed

1.3. Supplier

Praxair Canada inc.
1200 – 1 City Centre Drive
Mississauga - Canada L5B 1M2
T 1-905-803-1600 - F 1-905-803-1682
www.praxair.ca

1.4. Emergency telephone number

Emergency number : 1-800-363-0042
Call emergency number 24 hours a day only for spills, leaks, fire, exposure, or accidents involving this product.
For routine information, contact your supplier or Praxair sales representative.

SECTION 2: Hazard identification

2.1. Classification of the substance or mixture

GHS-CA classification

Simple asphyxiant H380
Compressed gas H280

2.2. GHS Label elements, including precautionary statements

GHS-CA labelling

Hazard pictograms : 
GHS04

Signal word : WARNING

Hazard statements : CONTAINS GAS UNDER PRESSURE; MAY EXPLODE IF HEATED
MAY DISPLACE OXYGEN AND CAUSE RAPID SUFFOCATION

Precautionary statements : Do not handle until all safety precautions have been read and understood
Use and store only outdoors or in a well-ventilated area
Protect from sunlight when ambient temperature exceeds 52°C (125°F)
Use a back flow preventive device in the piping
Close valve after each use and when empty
Use only with equipment rated for cylinder pressure

2.3. Other hazards

Other hazards not contributing to the classification : Asphyxiant in high concentrations.



Argon/Oxygen Mixture

Safety Data Sheet E-4718

according to the Hazardous Products Regulation (February 11, 2015)

Date of issue: 10-15-1979

Revision date: 08-11-2016

Supersedes: 10-15-2013

2.4. Unknown acute toxicity (GHS-CA)

No data available

SECTION 3: Composition/information on ingredients

3.1. Substances

Not applicable

3.2. Mixtures

Name	CAS No.	% (Vol)	Common Name (synonyms)
Argon	(CAS No) 7440-37-1	85.5401 - 99.9999	Argon, compressed
Oxygen (Component)	(CAS No) 7782-44-7	0.0001 - 14.4599	Oxygen (dissolved) / Oxygen gas / Oxygen, compressed / Oxygen, dissolved

SECTION 4: First-aid measures

4.1. Description of first aid measures

- First-aid measures after inhalation : Remove to fresh air and keep at rest in a position comfortable for breathing. If not breathing, give artificial respiration. If breathing is difficult, trained personnel should give oxygen. Call a physician.
- First-aid measures after skin contact : The liquid may cause frostbite. For exposure to liquid, immediately warm frostbite area with warm water not to exceed 105°F (41°C). Water temperature should be tolerable to normal skin. Maintain skin warming for at least 15 minutes or until normal coloring and sensation have returned to the affected area. In case of massive exposure, remove clothing while showering with warm water. Seek medical evaluation and treatment as soon as possible.
- First-aid measures after eye contact : Immediately flush eyes thoroughly with water for at least 15 minutes. Hold the eyelids open and away from the eyeballs to ensure that all surfaces are flushed thoroughly. Contact an ophthalmologist immediately. Get immediate medical attention.
- First-aid measures after ingestion : Ingestion is not considered a potential route of exposure.

4.2. Most important symptoms and effects (acute and delayed)

No additional information available

4.3. Immediate medical attention and special treatment, if necessary

Other medical advice or treatment : None.

SECTION 5: Fire-fighting measures

5.1. Suitable extinguishing media

Suitable extinguishing media : Use extinguishing media appropriate for surrounding fire.

5.2. Unsuitable extinguishing media

No additional information available

5.3. Specific hazards arising from the hazardous product

- Fire hazard : May accelerate combustion. Avoid contact with combustible materials.
- Reactivity : None.
- Reactivity in case of fire : No reactivity hazard other than the effects described in sub-sections below.

5.4. Special protective equipment and precautions for fire-fighters

- Firefighting instructions : Evacuate all personnel from the danger area. Use self-contained breathing apparatus (SCBA) and protective clothing. Immediately cool containers with water from maximum distance. Stop flow of gas if safe to do so, while continuing cooling water spray. Remove ignition sources if safe to do so. Remove containers from area of fire if safe to do so. On-site fire brigades must comply with their provincial and local fire code regulations.
- Protection during firefighting : Compressed gas: asphyxiant. Suffocation hazard by lack of oxygen.
- Special protective equipment for fire fighters : Standard protective clothing and equipment (Self Contained Breathing Apparatus) for fire fighters.

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.



Argon/Oxygen Mixture

Safety Data Sheet E-4718

according to the Hazardous Products Regulation (February 11, 2015)

Date of issue: 10-15-1979

Revision date: 08-11-2016

Supersedes: 10-15-2013

Specific methods : Use fire control measures appropriate for the surrounding fire. Exposure to fire and heat radiation may cause gas containers to rupture. Cool endangered containers with water spray jet from a protected position. Prevent water used in emergency cases from entering sewers and drainage systems

Stop flow of product if safe to do so

Use water spray or fog to knock down fire fumes if possible.

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

General measures : **DANGER!** MAY CAUSE CRYOGENIC BURNS OR INJURY. Wear cold-insulating gloves/face shield/eye protection. Evacuate area. Ensure adequate air ventilation. Wear self-contained breathing apparatus when entering area unless atmosphere is proven to be safe. Stop leak if safe to do so.

6.2. Methods and materials for containment and cleaning up

6.3. Reference to other sections

For further information refer to section 8: Exposure controls/personal protection

SECTION 7: Handling and storage

7.1. Precautions for safe handling

Precautions for safe handling : Wear leather safety gloves and safety shoes when handling cylinders. Protect cylinders from physical damage; do not drag, roll, slide or drop. While moving cylinder, always keep in place removable valve cover. Never attempt to lift a cylinder by its cap; the cap is intended solely to protect the valve. When moving cylinders, even for short distances, use a cart (trolley, hand truck, etc.) designed to transport cylinders. Never insert an object (e.g. wrench, screwdriver, pry bar) into cap openings; doing so may damage the valve and cause a leak. Use an adjustable strap wrench to remove over-tight or rusted caps. Slowly open the valve. If the valve is hard to open, discontinue use and contact your supplier. Close the container valve after each use; keep closed even when empty. Never apply flame or localized heat directly to any part of the container. High temperatures may damage the container and could cause the pressure relief device to fail prematurely, venting the container contents. For other precautions in using this product, see section 16.

Additional hazards when processed : When working with cryogenic/cold liquid or gas under pressure, avoid using materials that are incompatible with cryogenic use. Some metals, such as carbon steel, may fracture easily at low temperature. Use only transfer lines designed for cryogenic liquids. Prevent liquid or cold gas from being trapped in piping between valves. Equip the piping with pressure relief devices. Praxair recommends piping all vents to the exterior of the building.

7.2. Conditions for safe storage, including any incompatibilities

Storage conditions : Store in a cool, well-ventilated place. Store and use with adequate ventilation. Store only where temperature will not exceed 125°F (52°C). Firmly secure containers upright to keep them from falling or being knocked over. Install valve protection cap, if provided, firmly in place by hand. Store full and empty containers separately. Use a first-in, first-out inventory system to prevent storing full containers for long periods

OTHER PRECAUTIONS FOR HANDLING, STORAGE, AND USE: When handling product under pressure, use piping and equipment adequately designed to withstand the pressures to be encountered. Never work on a pressurized system. Use a back flow preventive device in the piping. Gases can cause rapid suffocation because of oxygen deficiency; store and use with adequate ventilation. If a leak occurs, close the container valve and blow down the system in a safe and environmentally correct manner in compliance with all international, federal/national, state/provincial, and local laws; then repair the leak. Never place a container where it may become part of an electrical circuit.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

No additional information available

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.

8.2. Appropriate engineering controls

Appropriate engineering controls : Oxygen detectors should be used when asphyxiating gases may be released. Systems under pressure should be regularly checked for leakages. Provide adequate general and local exhaust ventilation. Consider work permit system e.g. for maintenance activities.

8.3. Individual protection measures/Personal protective equipment

Personal protective equipment : Safety glasses. Face shield. Gloves.



Hand protection : Wear working gloves when handling gas containers.

Eye protection : Wear safety glasses with side shields. Select in accordance with the current CSA standard Z94.3, "Industrial Eye and Face Protection", and any provincial regulations, local bylaws or guidelines.

Skin and body protection : Wear work gloves when handling containers. Wear heavy rubber gloves where contact with product may occur.

Respiratory protection : **Respiratory protection:** Use respirable fume respirator or air supplied respirator when working in confined space or where local exhaust or ventilation does not keep exposure below TLV. Select in accordance with provincial regulations, local bylaws or guidelines. Selection should be based on the current CSA standard Z94.4, "Selection, Care, and Use of Respirators." Respirators should also be approved by NIOSH and MSHA. For emergencies or instances with unknown exposure levels, use a self-contained breathing apparatus (SCBA).

Thermal hazard protection : Wear cold insulating gloves when transfilling or breaking transfer connections.

Other information : **Other protection :** Safety shoes for general handling at customer sites. Metatarsal shoes and cuffless trousers for cylinder handling at packaging and filling plants. Select in accordance with the current CSA standard Z195, "Protective Foot Wear", and any provincial regulations, local bylaws or guidelines. For working with flammable and oxidizing materials, consider the use of flame resistant anti-static safety clothing.

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

Physical state	: Gas
Appearance	: Colorless gas.
Colour	: Colourless.
Odour	: Odourless.
Odour threshold	: No data available
pH	: Not applicable.
pH solution	: No data available
Relative evaporation rate (butylacetate=1)	: No data available
Relative evaporation rate (ether=1)	: Not applicable.
Melting point	: No data available
Freezing point	: No data available
Boiling point	: No data available
Flash point	: No data available
Auto-ignition temperature	: No data available
Decomposition temperature	: No data available
Vapour pressure	: Not applicable.
Vapour pressure at 50 °C	: No data available
Relative vapour density at 20 °C	: No data available
Relative density	: No data available
Relative density of saturated gas/air mixture	: No data available
Density	: 1.65 kg/m ³ Vapor density, 70°F (21.1°C), 1 atm (Based on the Argon component)
Relative gas density	: 1.38 (Based on the Argon component)
Solubility	: Water: No data available



Argon/Oxygen Mixture

Safety Data Sheet E-4718

according to the Hazardous Products Regulation (February 11, 2015)

Date of issue: 10-15-1979

Revision date: 08-11-2016

Supersedes: 10-15-2013

Log Pow	: Not applicable.
Log Kow	: Not applicable.
Viscosity, kinematic	: Not applicable.
Viscosity, dynamic	: Not applicable.
Viscosity, kinematic (calculated value) (40 °C)	: No data available
Explosive properties	: Not applicable.
Oxidizing properties	: None.
Flammability (solid, gas)	: Non flammable

9.2. Other information

Gas group	: Refrigerated liquefied gas
-----------	------------------------------

SECTION 10: Stability and reactivity

10.1. Reactivity

Reactivity	: None.
Chemical stability	: Stable under normal conditions.
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced. Using this product in welding and cutting may create additional hazards. The arc from electric arc welding may form gaseous reaction products such as carbon monoxide and carbon dioxide. Ozone and nitrogen oxides may be formed by the radiation from the arc. Other decomposition products of arc welding and cutting originate from the volatilization, reaction, and oxidization of the material being worked.

SECTION 11: Toxicological information

11.1. Information on toxicological effects

Acute toxicity (oral)	: Not classified
Acute toxicity (dermal)	: Not classified
Acute toxicity (inhalation)	: Not classified
Skin corrosion/irritation	: Not classified pH: Not applicable.
Serious eye damage/irritation	: Not classified pH: Not applicable.
Respiratory or skin sensitization	: Not classified
Germ cell mutagenicity	: Not classified
Carcinogenicity	: Not classified
Reproductive toxicity	: Not classified
Specific target organ toxicity (single exposure)	: Not classified
Specific target organ toxicity (repeated exposure)	: Not classified
Aspiration hazard	: Not classified

SECTION 12: Ecological information

12.1. Toxicity

Ecology - general	: No ecological damage caused by this product.
-------------------	--

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.



Argon/Oxygen Mixture

Safety Data Sheet E-4718

according to the Hazardous Products Regulation (February 11, 2015)

Date of issue: 10-15-1979

Revision date: 08-11-2016

Supersedes: 10-15-2013

12.2. Persistence and degradability

Argon/Oxygen Mixture

Persistence and degradability : No ecological damage caused by this product.

Oxygen (7782-44-7)

Persistence and degradability : No ecological damage caused by this product.

Argon (7440-37-1)

Persistence and degradability : No ecological damage caused by this product.

12.3. Bioaccumulative potential

Argon/Oxygen Mixture

BCF fish 1 : >=

Log Pow : Not applicable.

Log Kow : Not applicable.

Bioaccumulative potential : No ecological damage caused by this product.

Oxygen (7782-44-7)

Log Pow : Not applicable.

Log Kow : Not applicable.

Bioaccumulative potential : No ecological damage caused by this product.

Argon (7440-37-1)

Log Pow : Not applicable.

Log Kow : Not applicable.

Bioaccumulative potential : No ecological damage caused by this product.

12.4. Mobility in soil

Argon/Oxygen Mixture

Mobility in soil : No data available.

Log Pow : Not applicable.

Log Kow : Not applicable.

Oxygen (7782-44-7)

Mobility in soil : No data available.

Log Pow : Not applicable.

Log Kow : Not applicable.

Ecology - soil : No ecological damage caused by this product.

Argon (7440-37-1)

Mobility in soil : No data available.

Log Pow : Not applicable.

Log Kow : Not applicable.

Ecology - soil : No ecological damage caused by this product.

12.5. Other adverse effects

Other adverse effects : Can cause frost damage to vegetation.

Effect on the ozone layer : None

SECTION 13: Disposal considerations

13.1. Disposal methods

Waste treatment methods : May be vented to atmosphere in a well ventilated place. Consult supplier for specific recommendations. Do not discharge into any place where its accumulation could be dangerous. Contact supplier if guidance is required.

Waste disposal recommendations : Dispose of contents/container in accordance with local/regional/national/international regulations. Contact supplier for any special requirements.

SECTION 14: Transport information

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.



Argon/Oxygen Mixture

Safety Data Sheet E-4718

according to the Hazardous Products Regulation (February 11, 2015)

Date of issue: 10-15-1979

Revision date: 08-11-2016

Supersedes: 10-15-2013

14.1. Basic shipping description

In accordance with TDG

TDG

UN-No. (TDG) : UN1956
TDG Primary Hazard Classes : 2.2 - Class 2.2 - Non-Flammable, Non-Toxic Gas.
Proper shipping name : COMPRESSED GAS, N.O.S.
(Argon)

Explosive Limit and Limited Quantity Index : 0.125 L
Passenger Carrying Road Vehicle or Passenger Carrying Railway Vehicle Index : 75 L

14.3. Air and sea transport

IMDG

UN-No. (IMDG) : 1956
Proper Shipping Name (IMDG) : COMPRESSED GAS, N.O.S.
Class (IMDG) : 2 - Gases

IATA

UN-No. (IATA) : 1956
Proper Shipping Name (IATA) : Compressed gas, n.o.s.
Class (IATA) : 2

SECTION 15: Regulatory information

15.1. National regulations

Oxygen (7782-44-7)

Listed on the Canadian DSL (Domestic Substances List)

Argon (7440-37-1)

Listed on the Canadian DSL (Domestic Substances List)

15.2. International regulations

Oxygen (7782-44-7)

Listed on the AICS (Australian Inventory of Chemical Substances)
Listed on IECSC (Inventory of Existing Chemical Substances Produced or Imported in China)
Listed on the EEC inventory EINECS (European Inventory of Existing Commercial Chemical Substances)
Listed on the Korean ECL (Existing Chemicals List)
Listed on NZIoC (New Zealand Inventory of Chemicals)
Listed on PICCS (Philippines Inventory of Chemicals and Chemical Substances)
Listed on the United States TSCA (Toxic Substances Control Act) inventory
Listed on INSQ (Mexican national Inventory of Chemical Substances)

Argon (7440-37-1)

Listed on the AICS (Australian Inventory of Chemical Substances)
Listed on IECSC (Inventory of Existing Chemical Substances Produced or Imported in China)
Listed on the EEC inventory EINECS (European Inventory of Existing Commercial Chemical Substances)
Listed on the Korean ECL (Existing Chemicals List)
Listed on NZIoC (New Zealand Inventory of Chemicals)
Listed on PICCS (Philippines Inventory of Chemicals and Chemical Substances)
Listed on the United States TSCA (Toxic Substances Control Act) inventory
Listed on INSQ (Mexican national Inventory of Chemical Substances)

SECTION 16: Other information

Date of issue : 15/10/1979
Revision date : 11/08/2016
Supersedes : 15/10/2013

Indication of changes:

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.



Argon/Oxygen Mixture

Safety Data Sheet E-4718

according to the Hazardous Products Regulation (February 11, 2015)

Date of issue: 10-15-1979

Revision date: 08-11-2016

Supersedes: 10-15-2013

Other information

: When you mix two or more chemicals, you can create additional, unexpected hazards. Obtain and evaluate the safety information for each component before you produce the mixture. Consult an industrial hygienist or other trained person when you evaluate the end product. Before using any plastics, confirm their compatibility with this product

Fumes and gases produced during welding and cutting processes can be dangerous to your health and may cause serious lung disease. **KEEP YOUR HEAD OUT OF FUMES. DO NOT BREATHE FUMES AND GASES.** Use enough ventilation, local exhaust, or both to keep fumes and gases from your breathing zone and the general area. Short-term overexposure to fumes may cause dizziness, nausea, and dryness or irritation of the nose, throat, and eyes; or may cause other similar discomfort. Contaminants in the air may add to the hazard of fumes and gases. One such contaminant, chlorinated hydrocarbon vapors from cleaning and degreasing activities, poses a special risk. **DO NOT USE ELECTRIC ARCS IN THE PRESENCE OF CHLORINATED HYDROCARBON VAPORS—HIGHLY TOXIC PHOSGENE MAY BE PRODUCED.** Metal coatings such as paint, plating, or galvanizing may generate harmful fumes when heated. Residues from cleaning materials may also be harmful. **AVOID ARC OPERATIONS ON PARTS WITH PHOSPHATE RESIDUES (ANTI-RUST, CLEANING PREPARATIONS)—HIGHLY TOXIC PHOSPHINE MAY BE PRODUCED**

Praxair asks users of this product to study this SDS and become aware of the product hazards and safety information. To promote safe use of this product, a user should (1) notify employees, agents, and contractors of the information in this SDS and of any other known product hazards and safety information, (2) furnish this information to each purchaser of the product, and (3) ask each purchaser to notify its employees and customers of the product hazards and safety information

The opinions expressed herein are those of qualified experts within Praxair Canada Inc. We believe that the information contained herein is current as of the date of this Safety Data Sheet. Since the use of this information and the conditions of use are not within the control of Praxair Canada Inc, it is the user's obligation to determine the conditions of safe use of the product. Praxair Canada Inc, SDSs are furnished on sale or delivery by Praxair Canada Inc, or the independent distributors and suppliers who package and sell our products. To obtain current SDSs for these products, contact your Praxair sales representative, local distributor, or supplier, or download from www.praxair.ca. If you have questions regarding Praxair SDSs, would like the document number and date of the latest SDS, or would like the names of the Praxair suppliers in your area, phone or write Praxair Canada Inc, (Phone: 1-888-257-5149; Address: Praxair Canada Inc, 1 City Centre Drive, Suite 1200, Mississauga, Ontario, L5B 1M2).

PRAXAIR and the Flowing Airstream design are trademarks or registered trademarks of Praxair Technology, Inc. in the United States and/or other countries.

NFPA health hazard

: 0 - Exposure under fire conditions would offer no hazard beyond that of ordinary combustible materials.

NFPA fire hazard


: 0 - Materials that will not burn.

NFPA reactivity

: 0 - Normally stable, even under fire exposure conditions, and are not reactive with water.

NFPA specific hazard

: SA - This denotes gases which are simple asphyxiants.

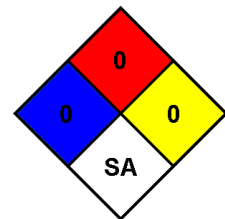

HMIS III Rating

Health

: 0 Minimal Hazard - No significant risk to health

Flammability

: 0 Minimal Hazard - Materials that will not burn

Physical

: 3 Serious Hazard - Materials that may form explosive mixtures with water and are capable of detonation or explosive reaction in the presence of a strong initiating source. Materials may polymerize, decompose, self-react, or undergo other chemical change at normal temperature and pressure with moderate risk of explosion

SDS Canada (GHS) - Praxair

This information is based on our current knowledge and is intended to describe the product for the purposes of health, safety and environmental requirements only. It should not therefore be construed as guaranteeing any specific property of the product.

This document is only controlled while on the Praxair Canada Inc. website and a copy of this controlled version is available for download. Praxair cannot assure the integrity or accuracy of any version of this document after it has been downloaded or removed from our website.